

ENVIRONMENTAL LAND SERVICES, INC.

3677 CENTRAL AVENUE SUITE G
 FORT MYERS, FLORIDA 33901
 PHONE: (239) 274-8022 ELS
 FAX: (239) 274-8019 LB 5986

BOUNDARY SURVEY:

A Parcel In Lot 26, East Stadler Farms, According To The Plat Thereof Recorded In Plat Book 5, Page 6, Of The Public Records Of Lee County, Florida, More Particularly Described As Follows:


Commence At The Southeast Corner Of Said Lot 26, Thence Run S 89°01'10" W For 8.00 Feet To The West Right Of Way Line Of Hartree Road; Thence Run N 00°01'10" W For 40.00 Feet To The North Line Of A Public Road Right Of Way; Thence Run S 89°40'10" W Along The Said North Line For 270.00 Feet To The Point Of Beginning; Thence Continue S 89°40'10" W For 120.00 Feet; Thence Run N 00°01'10" W For 210.40 Feet To The South Line Of A Bah Spur Right Of Way; Thence Run N 89°22'40" E For 120.00 Feet; Thence Run S 00°01'10" E For 211.01 Feet To The Point Of Beginning.

CERTIFIED TO:

David S. & Ann Manookian

STRAP #: 30-44-25-P1-00104.003B
 One Story Metal Warehouse
 #3170 Metro Parkway

STRAP #: 30-44-25-P1-00100.025E
 Vacant Land

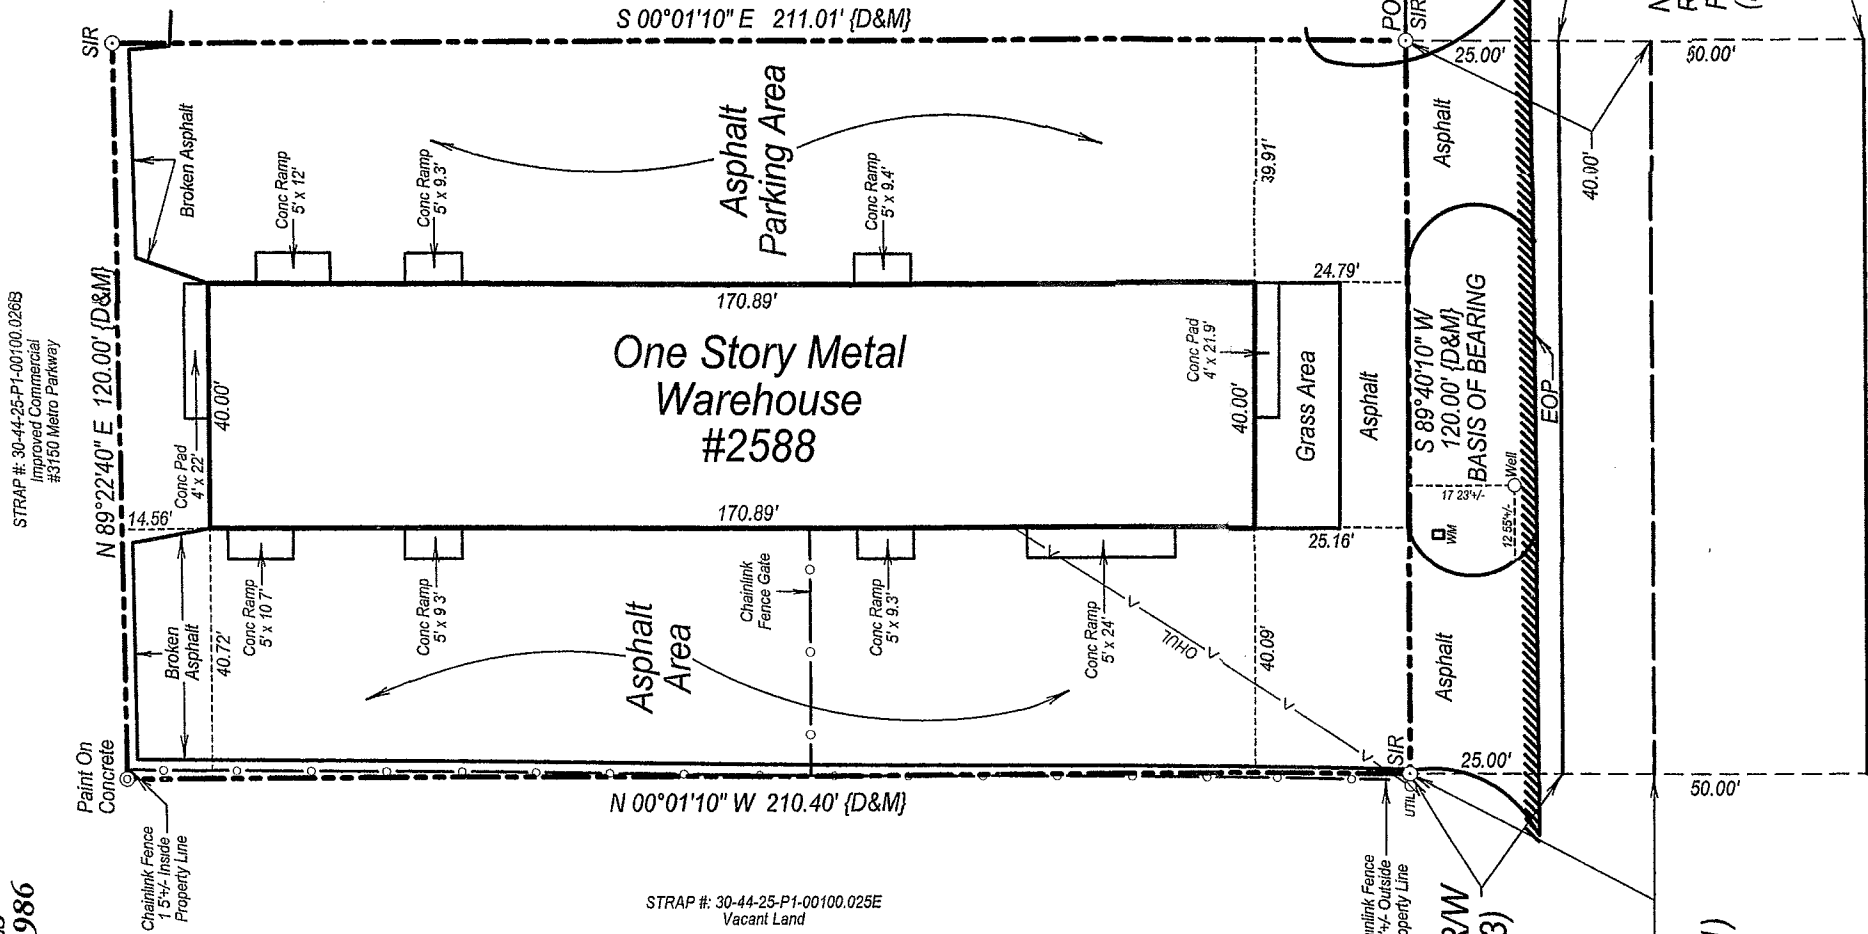

The Limit Of Road R/W
 (Per PB 5, Page 63)
 40.00' Reserved For
 Road R/W Purposes
 Tara Lee Street { Field }
 (Per ORB 1048, Page 1041)

Alfred J. Wainson
 ALFRED J. WAINSON
 PROFESSIONAL SURVEYOR AND MAPPER
 #2330-STATE OF FLORIDA

ABBREVIATIONS:

CL	=CALCULATED	ORB	=OFFICIAL RECORDS BOOK
CONC	=CONCRETE	PR	=PLAT BOOK
DEED	=DEED BOOK	POB	=POINT OF BEGINNING
EDG	=EDGE OF PAVEMENT	POC	=POINT OF COMMENCEMENT
FR	=FOUND IRON ROD	R/W	=RIGHT-OF-WAY
FM	=FOUND	SIR	=SET IRON ROD
M	=MEASURED	UTL	=UTILITY POLE
OH	=OVERHEAD UTILITY LINE	WM	=WATER METER

NOTE: All visible improvements and/or use has been either physically located and/or shown living within the subject property have not been located or shown. The sketch of survey was prepared without benefit of abstracts. ENVIRONMENTAL LAND SERVICES, INC. (ELS), and/or other than those provided by the client and/or shown on the recorded plat, Linda Sharon Heron and/or other persons have been used in the preparation of this survey. The survey was conducted on the date shown on the plat. This survey is void without the signature and stamp of a Florida Licensed Surveyor and Mapper. Address or telephone to the survey map(s) or report(s) by parties other than the signing party or parties is prohibited unless written consent of the signing party or parties.

Note: This sketch of survey is Not For Construction. Not For Fence Construction. This Survey Is Not Valid 90 Days After The Date Of Signature. NOTE: Underground Encroachments Not Located. Note: This Sketch Does Not Reflect or Determine Ownership. This Sketch Is Not an ALTA/ACSM Land Title Survey. Photocopying Prohibited, Copyrighted Material.

- NOTES:**
1. Description as furnished by Client. No search of the Public Records was conducted by this firm.
 2. Elevations as shown are based on NAD 83, 1929 datum unless otherwise stated.
 3. Bearings are based on Plat or Deed.
 4. Encroachments are based on Plat.
 5. There may be other easements not shown herein recorded in the Public Record of governing County.
 6. No Determination of Hazardous Waste Materials have been made by this firm.
 7. Signer limits liability only up to the cost of the survey.
 8. This Survey is protected by Copyright and All Rights are Reserved.
 9. Not Valid without signature and raised seal.

Date of Field Survey: 04/20/2007	Community Number: 125124	Sheet: B	Job Number: 2007-1090
Scale: 1" = 20.00'	Effective Date: 09/19/1984	Elevation: N/A	Checked By: RAW
Revision: _____	Firm Zone: B	Drawn By: JAR	
Date of Signature: 04/25/2007	Flood Zone Data: _____	REARINGS SHOWN HEREON ARE BASED ON: _____	
This Survey Is Not Valid 90 Days After The Date Of Signature		Southerly Most Property Line Per Deed Being S 89°40'10" W, { Assumed }	